Date	Device	Rationale			
05-Sep-23	Barrier-Free	Hoist Ropes have excessive wire breaks with rouge present at Floor #2.			
		drop test.			
05-Sep-23	Barrier-Free	Mast cover damaged/creased/folded zero running clearance			
05-Sep-23	Barrier-Free	Bottom landing interlock allows unit to run with door open up to ten inches			
05-Sep-23	Passenger Hydraulic	Failure of both Emergency Phone and Alarm Signaling Device			
05-Sep-23 Freight Hall Door Interlock does not prevent operation of elevator in unlo		Hall Door Interlock does not prevent operation of elevator in unlocked position			
		Emergency stop Switch inside elevator states "Pull to Stop" and Switch operates as a Push to stop Switch. When depressed, Elevator is allowed to run.			
05-Sep-23	Escalator	Handrail cracked over half way around of profile cross-section radius			
06-Sep-23	Escalator	Handrail Drive System Failure			
		Skirt Switch Failure			
06-Sep-23	Passenger Traction	Car Top Stop Switch, SOS Switch and Emergency Escape Hatch Switch are not operating. Jumper found in the controller.			
07-Sep-23	LULA	Noncompliance regarding Elevator Maintenance, Category 1 Testing and Category 5 Testing			
07-Sep-23	Barrier-Free	Device has been removed from service due to an invalid permit of operation.			
08-Sep-23	Passenger Traction	Drive sheave grooves are worn and at different depths			
09-Sep-23	Barrier-Free	Manual Lowering Device does not spring return and continues to descend uncontrollably when released.			
11-Sep-23	Passenger Traction	Damaged Governor Rope at Hitch Point			
12-Sep-23	Freight Winding Drum	Car Top Emergency Exit Switch/Plug Failure			
13-Sep-23	Passenger Traction	Failure of both Emergency Phone and Alarm Signaling Device			
18-Sep-23	Barrier-Free	Relief Valve Seal is Broken and Lift will not run in the up direction			
19-Sep-23	Barrier-Free	Invalid Permit of Operation			
19-Sep-23	Passenger Traction	Failure of both Emergency Phone and Alarm Signaling Device			
20-Sep-23	Passenger Hydraulic	Car Buffer is missing from the elevator pit			
27-Sep-23	Passenger Traction	Excessive wire breaks found in hoist ropes.			
29-Sep-23	Barrier-Free	Lift does not stop down travel when underpan is obstructed.			

		ı